

Sec. 23 E $\frac{1}{4}$ Cor.

Twp. Lincoln

9-27-38

Sept. 27,

Sec. 23 Twp. 87 Range 14

E $\frac{1}{4}$ Corner

Dug hole 20x20x9 found

niggerhead 19x17x9 on west Sec. 23-87-13

Shoulder of road 1 1/2 deep. Check

chaining from E. & W. indicated

cor should be N. & E. of stone found.

Established cor on straight line

between N. E. & S. E. cor. sec 23 and


on 1/4 fc. to W. line of trees &

road fc's & Co. bridge indicates

point established is more nearly in

correct position - Cor established (over)

6.5 E + 3.9 N. of niggerhead stone on shoulder of road.

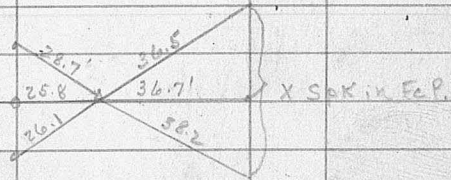

N.E. cor. sec 23

House

Shed

Barn

Crib

Barn

Sec. 23-87-14

Sec. 24-87-14

1X/SP

Steel Post 41.6

Brace Post 34.9

Corr Post 33.3

Brace 34.4

44.9

35.1

33.4

34.2

36.3

45.0

2633.2'

1923.0'

1210.2'

2626.6'

1307.4'

1319.2'

N.

2656.8'

Straight line

S.E. cor. sec 23

2659.0'

1325.7'

1333.3'